

Date: Friday, 10/10/2008 12:57:03 PM
 User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	350/355 AS X-TUBE AFT
Job Number :	42538		
Estimate Number :	12486		
P.O. Number :		Part Number :	D350748201
This Issue :	10/10/2008	Drawing Number :	N/A
Prsht Rev. :	NC	Project Number :	N/A
First Issue :	//	Drawing Revision :	D
Previous Run :	42537	Material :	
Written By :		Due Date :	22/10/2008
Checked & Approved By :	<u>JLD 08-10-10</u>	Qty:	1 Um: Each
Comment :	Est Rev: A New Issue 06-07-05 JLM Est Rev: B Update qty of MS21042L5 06-09-12 KJ Est Rev C Combined manufacturing 08.04.02 EC verified by: DD Est Rev:D 08-06-24 revD as per dwg DD verified by:EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: Photocopy bluefile & type labels per PPPD350-748-201 CHG001

2.0	D350748241TRN	Crosstube Turning Detail
-----	---------------	--------------------------



Comment: Qty: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
 CROSSTUBE TURNING DETAIL
 batch B42484

MB 08-11-19

3.0	BENDING	BENDING MACHINE - SKIDTUBES
-----	---------	-----------------------------



Comment: BENDING MACHINE

Bend tube as per Dwg D350-748-241 using CNC bender program D350A and Folio FT

MB 08-11-19

4.0	QC15	DIMENSIONAL CHECK OF X-TUBES
-----	------	------------------------------



Comment: DIMENSIONAL CHECK OF X-TUBES

MB 08-11-24

5.0	CROSSTUBES	CROSSTUBES RESOURCE 1
-----	------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1-Remove all marks from tube within limits of D350-748-241

MB 08-11-24

2-Drill Tube as per Dwg D350-748-241 Using DT8876 Drill Jigs,
 Set-up drill table as per QSI 010

MB 08-11-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/10/2008 12:57:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT

Job Number: 42538

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

3-Deburr

5- Apply LP3 Batch : m109539- F2 08/11/27 MB 08-11-26
4-Engrave Part # and Batch # as per Dwg D350-748-241

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

561627 @

7.0

OUTSIDE SERV.10

OUTSIDE SERVICES -skids



Comment: Sub-Contracting OUTSIDE SERVICES -

Issue P/O: 7700

Stress relief at 375° for 5 hours

Magnetic Particle Inspect per ASTM E1444

Cadium Plate per AMS-QQ-P-416B, Class 1, Type 2

Embrittle relief at 375° for 8 hours, Chromate Treat

Possible Supplier: Southwest United Industries

Ensure Certificate of Conformity is attached

CLO811/27

①

8.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Receive & Inspect For Transit Damage

Ensure certificate of conformity is attached

8/12/22 ①

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08-12-23 @

10.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside crosstube as per QSI 005 4.2

2-Paint Outside of Tube as per Dart QSI 005 4.2

27 08-12-23

11.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

08 12 24 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/10/2008 12:57:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT

Job Number: 42538

Part Number: D350748201

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

12.0	D2856400	Abrasion Strip
------	----------	----------------



Comment: Qty.: 1.2401 f(s)/Unit Total : 1.2401 f(s)

Abrasion Strip 7.10" long x2

Batch: 37667

ml 08 12 29

13.0	ALS41032225	Insert
------	-------------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Insert

Batch: 109817

ml 08 12 29

14.0	AN960JD10	Washer
------	-----------	--------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Washer

Batch: 105442

ml 08 12 29

15.0	MS2192020	Clamp (per MIL-DTL-8783C)
------	-----------	---------------------------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Clamp (per MIL-DTL-8783C)

Batch: 109715

ml 08 12 29

16.0	MS27039110	Screw
------	------------	-------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Screw

Batch: 18836

ml 08 12 29

17.0	CROSSTUBES	CROSSTUBES RESOURCE 1
------	------------	-----------------------



Comment: LANDING GEAR RESOURCE 1

1-Install Ground wire Insert, then insert screw and washer

2-Install Abrasion strips as per Dwg D350-748-241 & QSI 035.

3-Install supports Using Dt8876 as per Dwg D350-748-241, Torque to 60-80 IN-LBS

ml 08 12 29 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/10/2008 12:57:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT

Job Number: 42538

Part Number: D350748201

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

18.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08.2.30 (1)

19.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

20.0

D35001

Saddle



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

350 SADDLE

Batch: 1341555

41602 (2)

21.0

D35021

Support



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

SUPPORT

Batch: 42968

ml 08 12 29

SP
PTD

22.0

D35011

Bushing



Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s)

BUSHING

Batch: 1339726

23.0

AN46A

Bolt



Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s)

Bolt

Batch: M109545

24.0

AN441A

bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)



bolt

Batch: M1091068 (2)

M109632 (6)

8/12/30

SP
(X)
SP

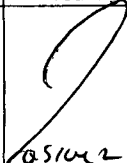W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
05-12-30	210	D3502-1 goes to the Assy pick list. perm change						

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/10/2008 12:57:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT

Job Number: 42538

Part Number: D350748201

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

25.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: M109752

SP

26.0

AN960JD416

Washer



Comment: Qty.: 32.0000 Each(s)/Unit Total : 32.0000 Each(s)

Washer

Batch: M109249

SP

27.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Washer

Batch: M109752

SP

28.0

MS21042L4

Nut



Comment: Qty.: 24.0000 Each(s)/Unit Total : 24.0000 Each(s)

Nut

Batch: M108145

SP

29.0

MS21042L5

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Nut

Batch: M109297

8/12/30

SP

30.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

0512-300

31.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-748-201

Location:

PPP Rev:

02/11/5

SP

(X)

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE		By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Friday, 10/10/2008 12:57:03 PM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT

Job Number: 42538

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

①
D09/01/06

Job Completion



MF 09-01-06

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	42538
Description: Crosstube High Aft (AS350/355)		Part Number:	D350-748-201
Inspection Dwg: D350-748-241 Rev: D		Page 1 of 1	

Required Dimension	Min	Max
Height	31.22	31.48
1/2 Span	40.77	41.03
Angle	75	77
Total Span	81.54	82.06

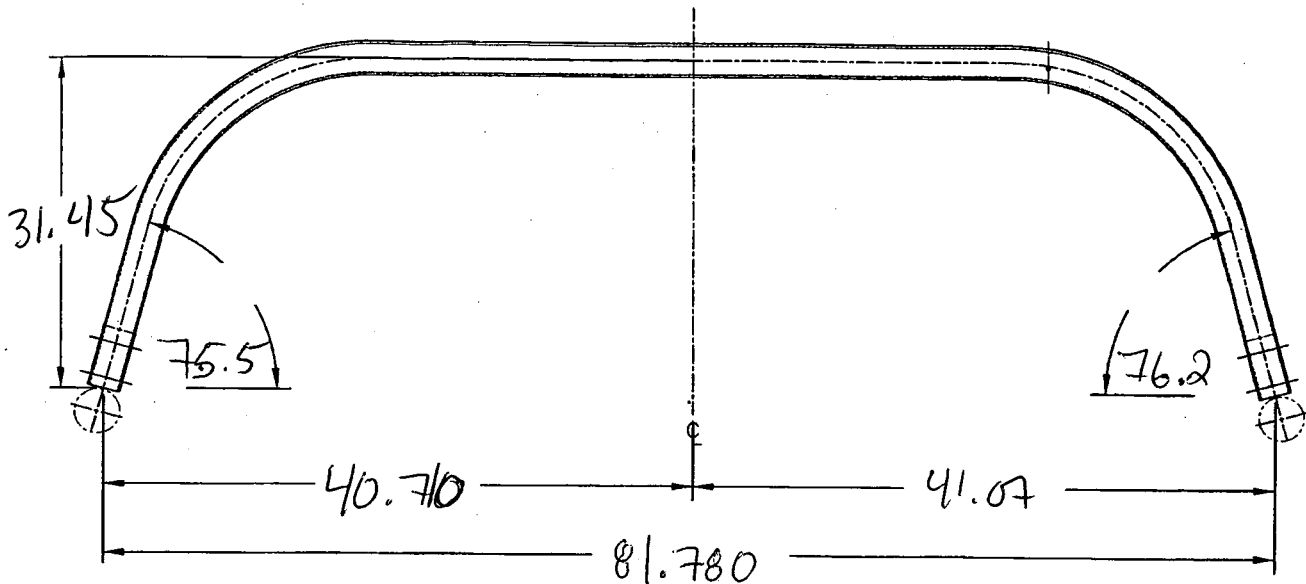

Comments

QC15 Inspection	<i>[Signature]</i>
Date	

08.11.24

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM <i>[Signature]</i>	<i>[Signature]</i>

DART

DESIGN QP	DRAWN BY QP	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED ///	APPROVED ///	DRAWING NO. D350-748-241	REV. D SHEET 1 OF 3
DATE 06.10.31		TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE NTS
A	06.03.31	NEW ISSUE	
B	06.06.30	ADD D6018-125 & PRIME AND PAINT	
C	06.08.14	ADD CAD PLATING	
D	06.10.31	MAG. PARTICLE AND CAD PLATE AS MFD.	

RELEASED06.10.31 **///**

QTY	P/N	DESCRIPTION
X	D350-748-241	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
1	D6018-125	CROSSTUBE (OR D6015-125)
2	D3502-1	SUPPORT
2	D2856-400-710	ABRASION STRIP
1	AELS-1032-225	INSERT
1	AN960JD10	WASHER
2	MS21920-20	CLAMP (PER DART SPEC. M-MS21920-20)
1	MS27039-1-10	SCREW

D350-748-141 CROSSTUBE:


- 1) MATERIAL: MANUFACTURED FROM D6018-125 OR D6015-125
FINISHED LENGTH = 122.70±0.06
- 2) MACHINE PER MACHINING DETAIL ON PAGE 3. BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITIONS SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 3) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 4) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 5) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS 2759-1C AFTER TURNING
- 6) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2
CADMIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 7) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.
- 8) INSTALL D2856-400-710 ABRASION STRIP WITH A GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 9) TORQUE MS21920-20 CLAMPS 60 TO 80 IN-LB
- 10) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 11) ALL DIMENSIONS ARE IN INCHES
- 12) PART IS SYMMETRIC ABOUT CENTERLINE EXCEPT FOR Ø0.297 HOLE.

SHOP COPY
RETURN TO
ENGINEERING
CONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 42538

UNDER REVIEW
07.02.16 **///**
CUT FOR REDUCED
07.02.16 **///**



Copyright © 2006 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

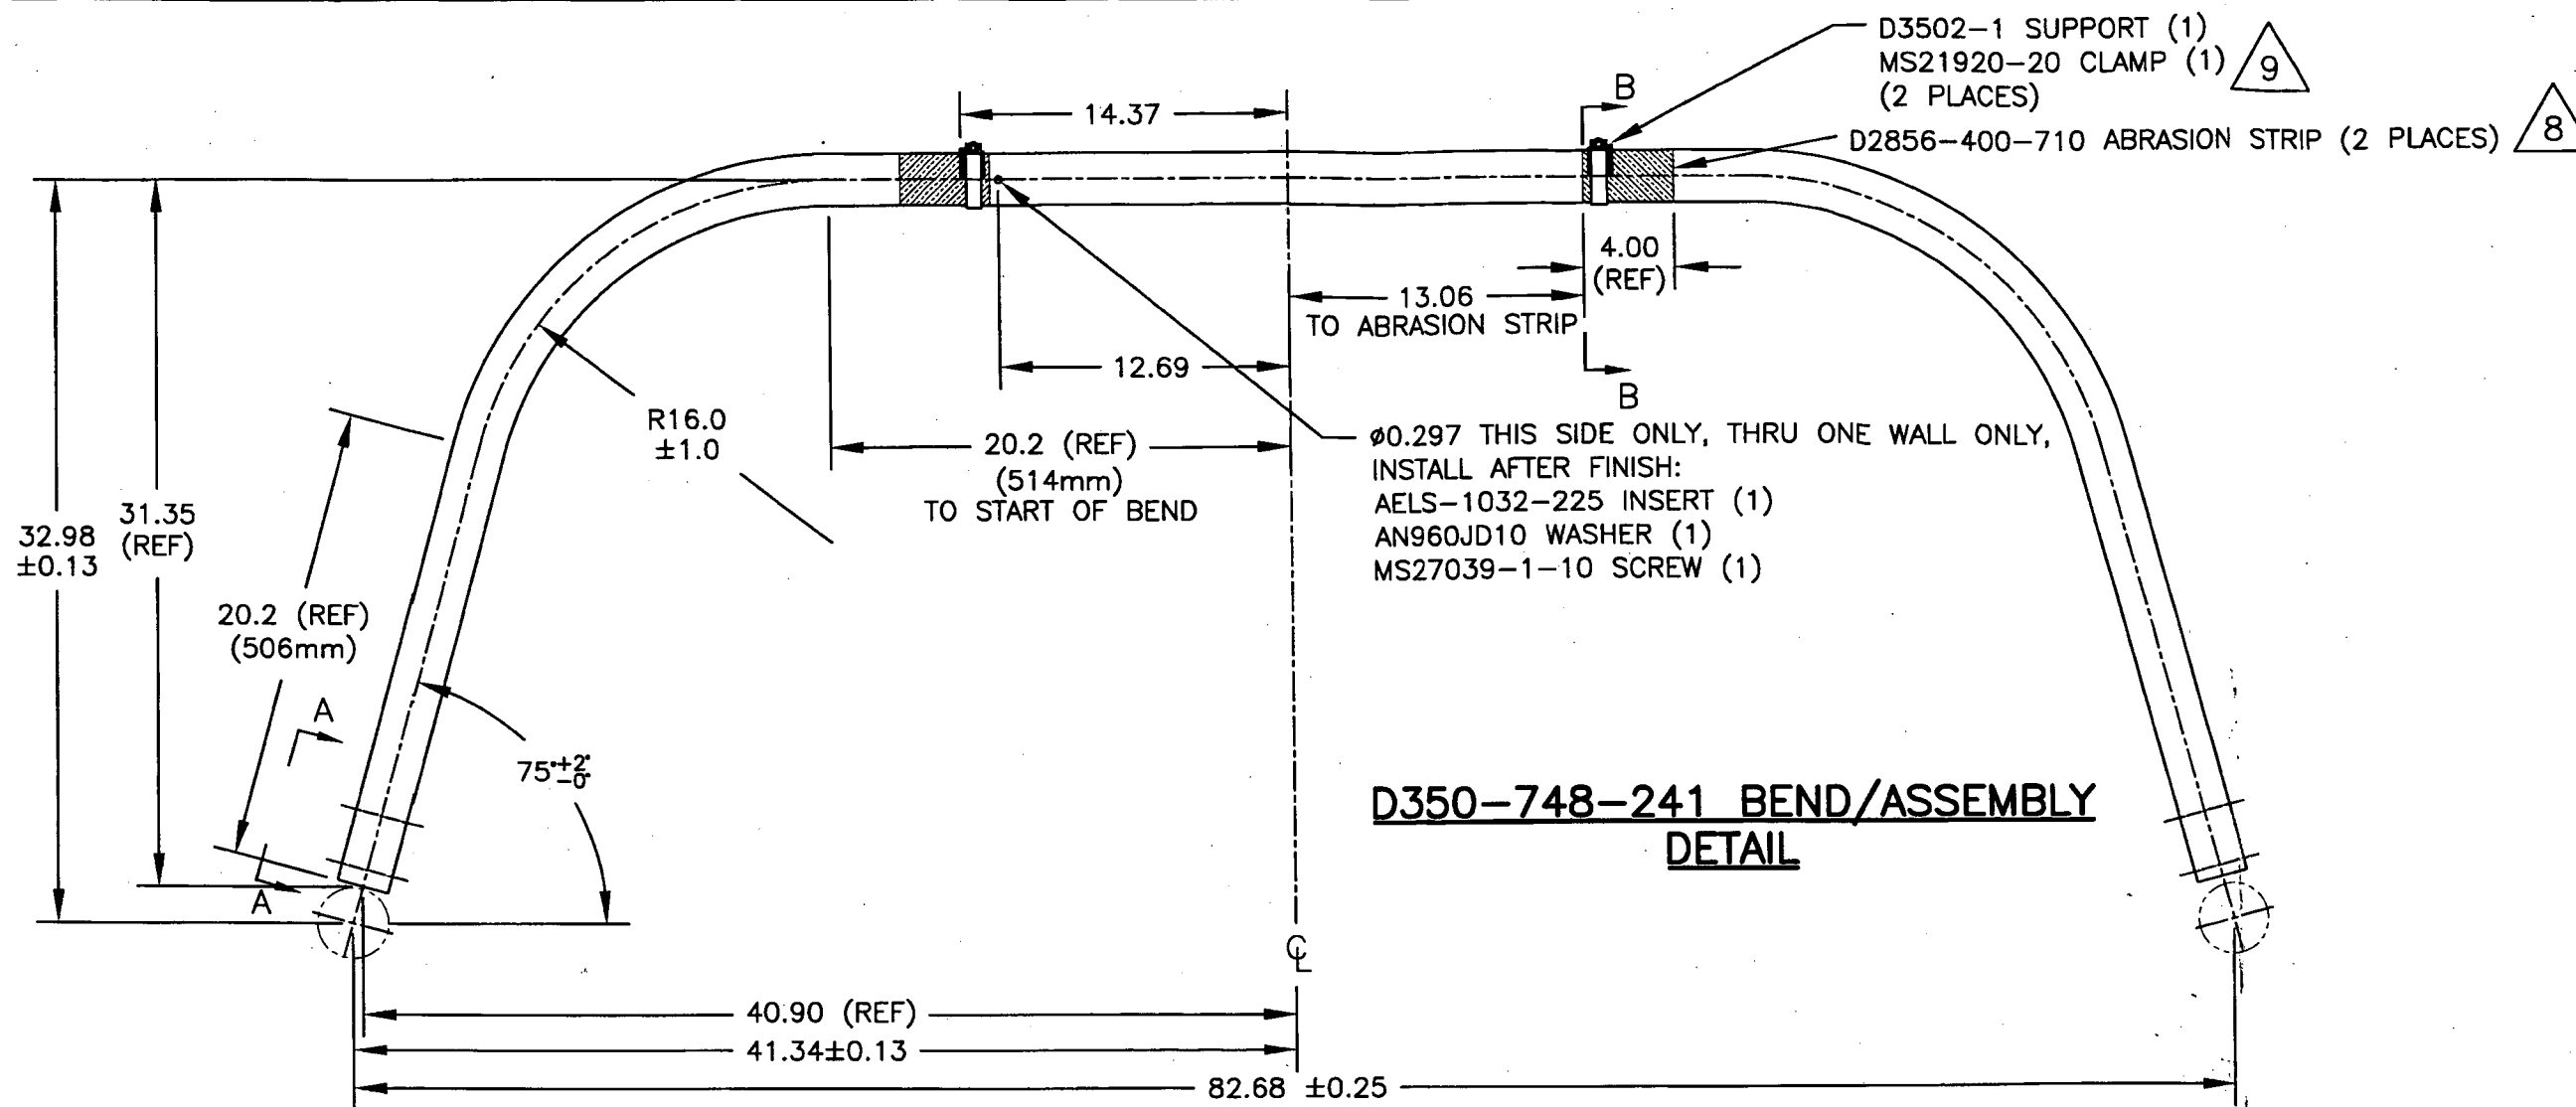

D350-748-241 BEND/ASSEMBLY DETAIL

SECTION B-B SCALE 1:2

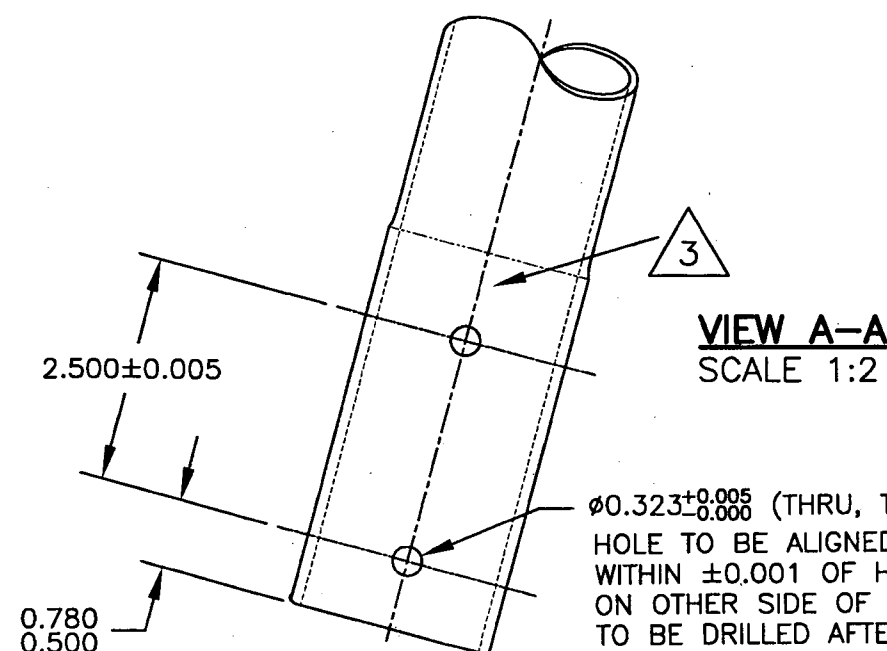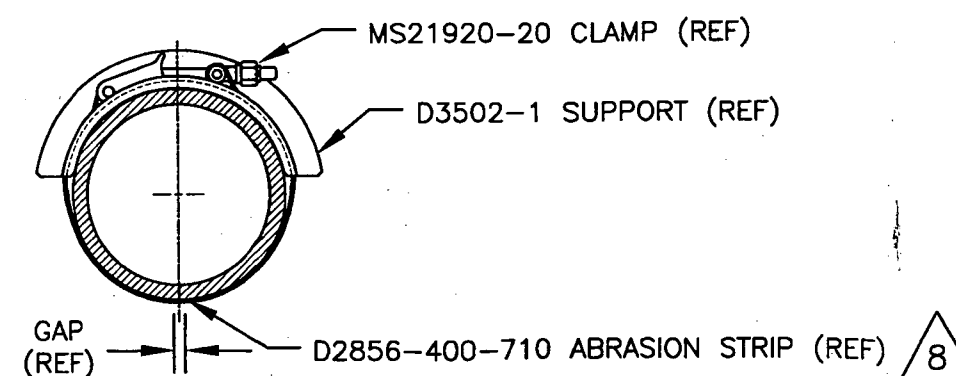

VIEW A-A SCALE 1:2


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER NO. 42538
07.02/16
CUFF BEND REDUCED
06.07.22

RELEASED
06.10.31

COPYRIGHT © 2008 BY DART AEROSPACE LTD.



THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DESIGN qp	DRAWN BY qp	DART	DART AEROSPACE LTD. HAWKESBURY, ONTARIO, CANADA
CHECKED H	APPROVED H	DRAWING NO. D350-748-241	REV. D SHEET 2 OF 3
DATE 06.10.31	TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE 1:8	

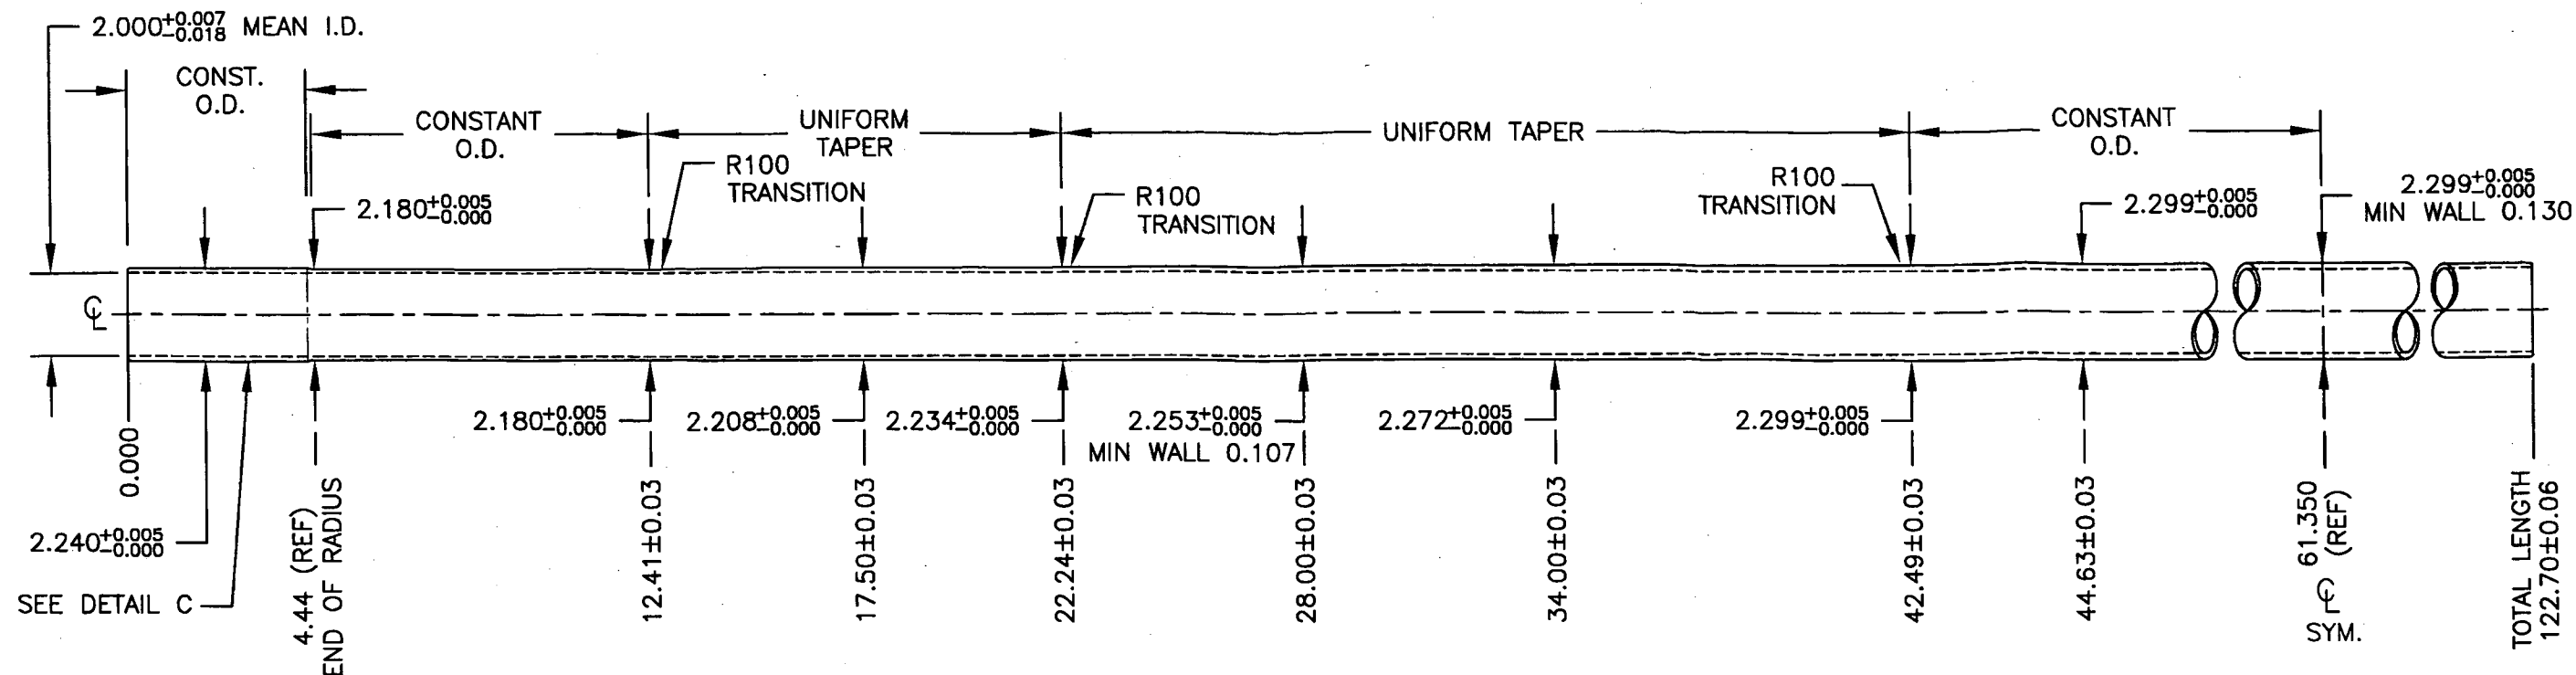

D350-748-241 MACHINING DETAIL

DETAIL C: CUFF
SCALE 1:1

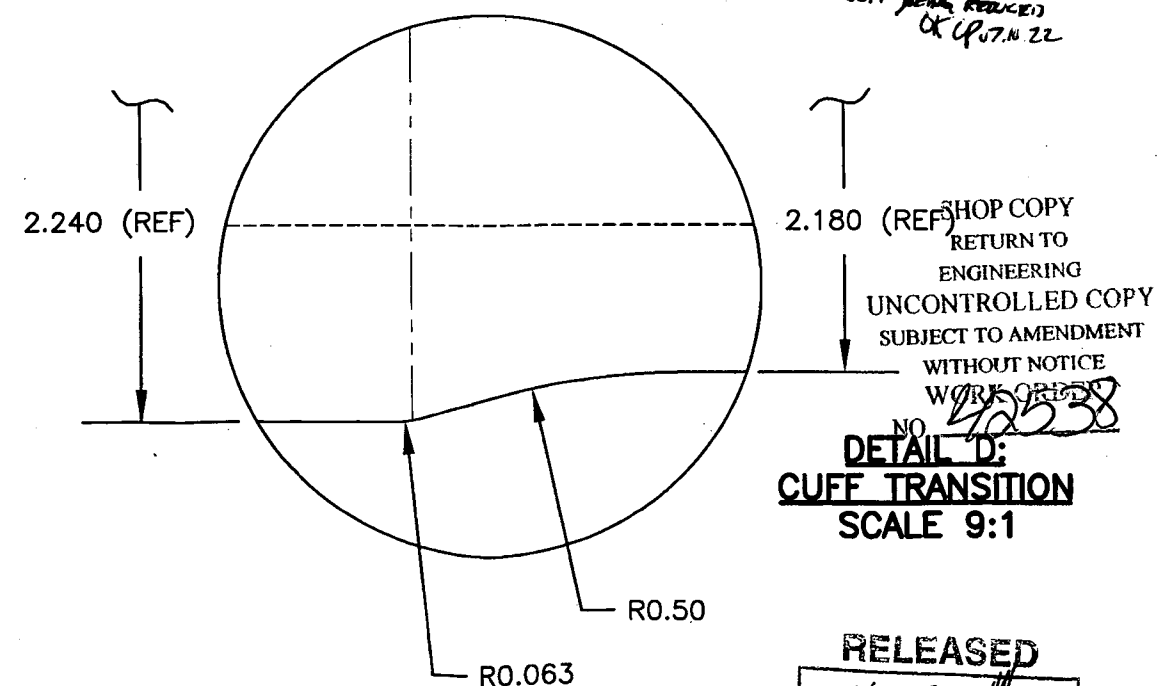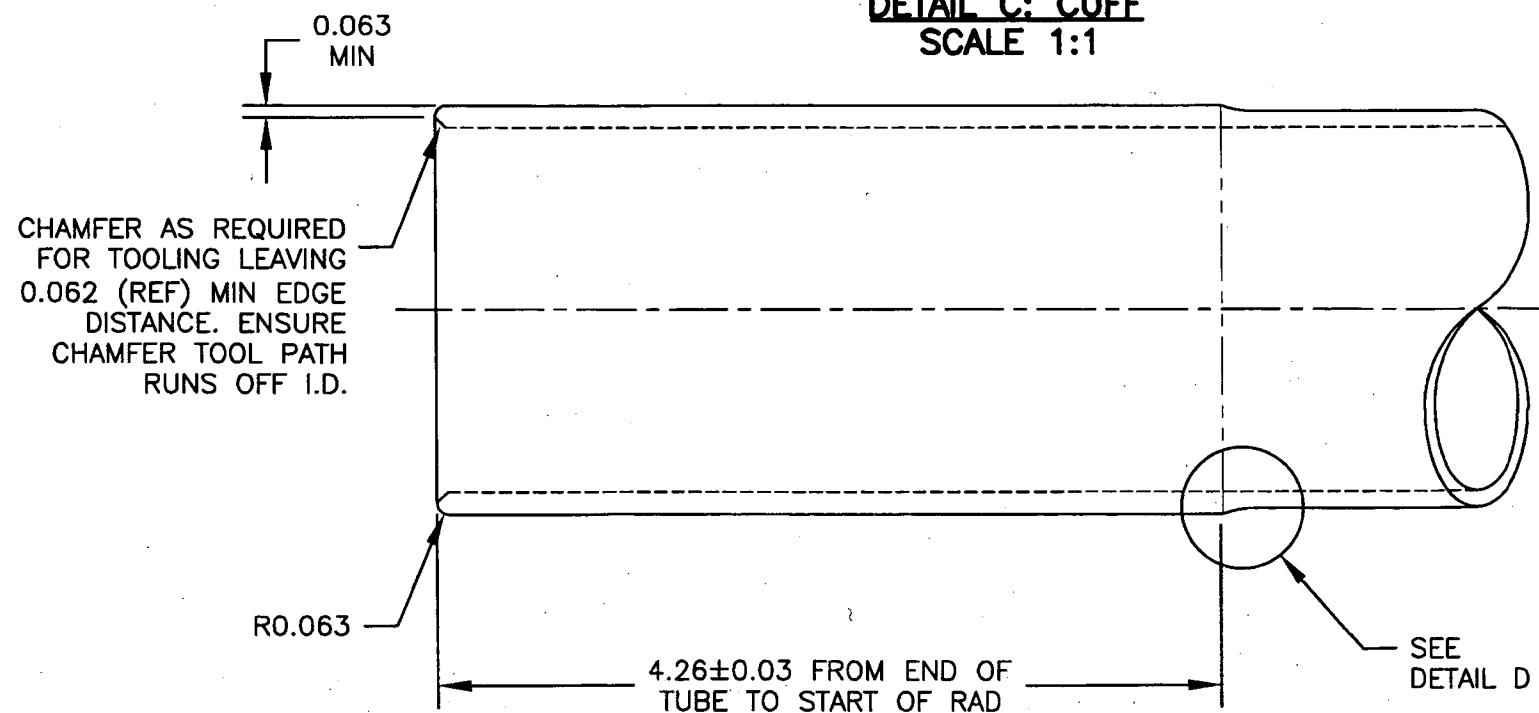

COPYRIGHT © 2006 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN qp	DRAWN BY qp	DART	DART AEROSPACE LTD. HAMKESBURY, ONTARIO, CANADA
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D350-748-241	REV. D SHEET 3 OF 3
DATE 06.10.31	TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE 1:4	

Packing Slip

Sold To:

Dart Aerospace Ltd.
1270 Aberdeen St.

Hawksbury, ON K6A 1K7

ShipTo:

Cadorath Plating Co. Ltd.

2150 Logan Avenue, Winnipeg, Manitoba R2R-0J2

Phone: (204) 633-9420 Fax: (204) 633-8033

INVOICE NUMBER:

42387

Net 2% Interest Per Month charged on Overdue Accounts.

Any claims for shortages, overcharges, or damaged goods must be made within seven (7) days from receipt of goods.

Customer Order #:	Date Received:	Terms:	G.S.T. #:	Ship Via:	Ship Date:
00007700	Dec-08-2008	NET 30 DAYS	10071 6547 RT0001		Dec-17-2008

Item #	Qty	P/N & Description	
1	1 EA	SKID	S/N B43336
		P/N d350-748-101	W/O 82376
2	1 EA	SKID	S/N B43337
		P/N d350-748-101	W/O 82377
3	1 EA	SKID	S/N B43339
		P/N d350-748-101	W/O 82378
4	1 EA	SKID	S/N B42538
		P/N d350-748-101	W/O 82379

**CERTIFICATE OF
CONFORMANCE**

**CADORATH PLATING CO. LTD.
2150 LOGAN AVENUE
WINNIPEG, MANITOBA R2J-0J1**

DATE: Dec-17-2008

**CONSIGNED TO: Dart Aerospace Ltd.
1270 Aberdeen St.
Hawksbury, ON K6A 1K7**

**W/O #: 82379
INVOICE #: 42387**

**CONTRACT OR
PURCHASE ORDER # 00007700**

DESCRIPTION: SKID

QTY 1

P/N # d350-748, 101

S/N # B42538

**STRESS RELIEF BAKE @ 375 FOR 5 HRS HEAT CHART # 9921. MPI
INSPECTED IAW ASTM E 1444. CADMIUM PLATED IAW AMS-QQ-P-
416B, TYPE 2 YELLOW, CLASS 2. BAKE HEAT CHART # 9967.**

**CERTIFICATE: I certify that the items indicated here on have
been inspected and tested and conform to all specifications
and requirements detailed on the contract or purchase order.**

Approved Inspector:



A large, stylized handwritten signature.

Date: Thursday, 18/12/2008 9:12:35 AM
 User: Julie Dawson

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: 350/355 AS X-TUBE AFT
Job Number	: 42538		
Estimate Number	: 12486		
P.O. Number	:	Part Number	: D350748201
This Issue	: 18/12/2008	S.O. No.	:
Prsht Rev.	: NC	Drawing Number	: N/A
First Issue	: 10/10/2008	Project Number	: N/A
Previous Run	: 42537	Drawing Revision	: D
		Material	:
Written By	:	Due Date	: 22/10/2008
Checked & Approved By	:	Qty:	1 Um: Each
Comment	: Est Rev: A New Issue 06-07-05 JLM : Est Rev: B Update qty of MS21042L5 06-09-12 KJ : Est Rev C Combined manufacturing 08.04.02 EC verified by: DD : Est Rev:D 08-06-24 revD as per dwg DD verified by:EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
----------------	------------------------------	----------------------

1.0

DC

DOCUMENT CONTROL



JUD 08.12.18



Comment: Photocopy bluefile & type labels per PPPD350-748-201 CHG001

2.0

D350748241TRN

Crosstube Turning Detail



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
 CROSSTUBE TURNING DETAIL
 batch _____

3.0

BENDING

BENDING MACHINE - SKIDTUBES

**Comment:** BENDING MACHINE

Bend tube as per Dwg D350-748-241 using CNC bender program D350A and Folio FT _____

Job Completion

